



ISO 9001:2015 CERTIFIED

ENGINEERS • PLANNERS • SCIENTISTS • CONSTRUCTION MANAGERS

936 Ridgebrook Road • Sparks, MD 21152 • Phone 410-316-7800 • Fax 410-316-7817

June 12, 2023

Mr. Brian Croyle, Environmental Specialist  
Montgomery County Public Schools  
Division of Sustainability and Compliance  
8301 Turkey Thicket Drive  
Gaithersburg, MD 20879

Ref: **Monitoring for Total Volatile Organic Compounds – 6/9/2023**  
Poolesville High School  
KCI Job No. 122302497

KCI Technologies Inc. (KCI) is submitting the following letter report detailing the findings of Total Volatile Organic Compounds (TVOCs) screening at Poolesville High School located at 17501 W. Willard Rd. Poolesville, MD 20837 (subject site). Testing was performed by KCI's Industrial Hygienist, Ms. Brittany Maas, under the oversight of KCI's Certified Industrial Hygienist (CIH), Mr. Jonathan Coale.

**Background:**

At Poolesville High School, the current renovations and construction has raised concerns from student's parents regarding air quality within the facility. Students and faculty have voiced concerns related to an odor present in the school while construction activities are occurring on the roof of the existing structure. The parents are concerned the students are being exposed to potentially hazardous conditions related to the asphalt fumes being produced during the roofing installation. MCPS retained KCI to assist in collecting data on the school's occupants' potential exposure to emissions from roofing work being conducted.

In addition to the current scope that includes testing for asphalt fumes and hydrogen sulfide, MCPS requested KCI utilize a Photoionization Detector (PID) with a 10.6 eV lamp to perform real-time TVOC screening in various locations throughout the interior and exterior of the school up to 3 days a week, for 6 weeks (April 26<sup>th</sup> through June 9<sup>th</sup>). Utilizing a PID will allow KCI to detect real-time TVOC concentrations (measured in part per million - ppm) in areas of concern and report back to MCPS quickly. The PID will capture TVOCs concentrations but won't provide selective information on individual VOCs.

The purpose of this screening is to determine if concentrations of TVOCs are present, and to what degree, in real-time. The data obtained from the screening may suggest if specific VOCs should be screened for at the facility.

It is important to note that VOCs can be produced from many sources including but not limited too; paints/solvents, building materials, cleaning agents and other chemicals, perfumes, cosmetics, carpet, smoking, etc. This may produce background VOC levels unrelated to the roofing.

There are currently no standards set for TVOCs but they are a reliable indicator of potential Indoor Air Quality (IAQ) concerns. Occupational exposure standards vary depending on specific VOCs and their

*Employee-Owned Since 1988*

impact on human health. The EPA has found that the levels of VOCs average 2 to 5 times higher indoors than outdoors and up to 1,000 times higher several hours after activities such as painting or cleaning. For the purpose of this project, the initial site visit performed on 4/26/2023 may provide insight on areas that have higher TVOC concentrations than others. This should indicate where KCI should focus additional sampling efforts.

Description of the Work Performed:

On June 9, 2023, KCI utilized a RAE Systems MiniRAE 3000 Photoionization Detector (PID) with a 10.6 eV lamp to perform real-time TVOC monitoring in various locations throughout the interior and exterior of the school. KCI's IH collected data in areas where complaints were received from students and in areas where the IH smelled asphalt fumes.

To record data, each hour KCI walked to different locations throughout the school and the school's perimeter. Specific areas that were screened included: near all established air sampling locations associated with the ongoing air quality monitoring, throughout the 1<sup>st</sup> and 2<sup>nd</sup> floor of the science building, throughout the main building, downwind of the roofing work, the student parking lot near the gate entrance to the construction site, and the west end of the portable units. KCI stood in each location for approximately five (5) minutes to allow for the PID to stabilize and obtain accurate readings of each area.

KCI conducted the screening from approximately 07:45 until 14:00. Conditions during the sampling period were mostly sunny with temperatures between 64°F - 78°F. Winds were between 0 and 13mph with gusts up to 17mph from NW, WNW, N, NW, and NNW.

Results:

Table 1 summarizes the locations readings were taken from and concentrations detected.

| <b>Table 1 – TVOC Monitoring Summary</b> |                    |                            |
|--|--------------------|----------------------------|
| <b>Location</b>                          | <b>Sample Time</b> | <b>Concentration (ppm)</b> |
| Media Center Hallway – Outside Room 37   | 8:00 – 8:30        | 0.0                        |
|  | 9:00 – 9:30        | 0.0                        |
|  | 10:00 – 10:30      | 0.0                        |
|  | 11:00 – 11:30      | 0.0                        |
|  | 12:00 – 12:30      | 0.0                        |
|  | 1:30 – 2:00        | 0.0                        |
| Arts Hallway – Outside Room 44           | 8:00 – 8:30        | 0.0                        |
|  | 9:00 – 9:30        | 0.0                        |
|  | 10:00 – 10:30      | 0.0                        |
|  | 11:00 – 11:30      | 0.0                        |
|  | 12:00 – 12:30      | 0.0                        |
|  | 1:30 – 2:00        | 0.0                        |
| Auditorium Lobby                         | 8:00 – 8:30        | 0.0                        |
|  | 9:00 – 9:30        | 0.0                        |
|  | 10:00 – 10:30      | 0.0                        |
|  | 11:00 – 11:30      | 0.0                        |
|  | 12:00 – 12:30      | 0.0                        |
|  | 1:30 – 2:00        | 0.0                        |

| <b>Table 1 – TVOC Monitoring Summary</b>                                |                    |                            |
|---|--------------------|----------------------------|
| <b>Location</b>   | <b>Sample Time</b> | <b>Concentration (ppm)</b> |
| Science Building – Throughout 1 <sup>st</sup> and 2 <sup>nd</sup> Floor | 8:00 – 8:30        | 0.0 – 0.3                  |
|   | 9:00 – 9:30        | 0.0 – 0.3                  |
|   | 10:00 – 10:30      | 0.0 – 0.6                  |
|   | 11:00 – 11:30      | 0.0 – 0.4                  |
|   | 12:00 – 12:30      | 0.0 – 0.1                  |
|   | 1:30 – 2:00        | 0.0 – 0.3                  |
| Downwind of Roofing Work (Exterior)                                     | 8:00 – 8:30        | 0.0                        |
|   | 9:00 – 9:30        | 0.0                        |
|   | 10:00 – 10:30      | 0.0                        |
|   | 11:00 – 11:30      | 0.0                        |
|   | 12:00 – 12:30      | 0.0                        |
|   | 1:30 – 2:00        | 0.0                        |
| Construction Entrance in Student Parking Lot (Exterior)                 | 8:00 – 8:30        | 0.1                        |
|   | 9:00 – 9:30        | 0.0                        |
|   | 10:00 – 10:30      | 0.0                        |
|   | 11:00 – 11:30      | 0.0                        |
|   | 12:00 – 12:30      | 0.0                        |
|   | 1:30 – 2:00        | 0.0                        |
| West End of Portables (Exterior)  | 8:00 – 8:30        | 0.1                        |
|   | 9:00 – 9:30        | 0.0                        |
|   | 10:00 – 10:30      | 0.0                        |
|   | 11:00 – 11:30      | 0.0                        |
|   | 12:00 – 12:30      | 0.0                        |
|   | 1:30 – 2:00        | 0.0                        |
| Bus Loop / Staff Parking Lot  | 8:00 – 8:30        | 0.1                        |
|   | 9:00 – 9:30        | 0.0                        |
|   | 10:00 – 10:30      | 0.0                        |
|   | 11:00 – 11:30      | 0.0                        |
|   | 12:00 – 12:30      | 0.0                        |
|   | 1:30 – 2:00        | 0.0                        |
| Notes: ppm – Parts Per Million  |                    |                            |

Conclusion:

The screening identified nondetectable to low TVOC concentrations as stated in Table 1.

In conclusion, roofing activities do generate VOC emissions which is expected. Depending on the work procedures and wind direction, VOCs may be incidentally introduced into the indoor air. It was noted the higher levels in the science center building were most likely due to the dissections taking place in the science lab on June 9, 2023.


KCI will continue to actively monitor for VOCs every Monday, Wednesday, and Friday that school is in session and will report findings daily to MCPS.

Mr. Brian Croyle  
June 12, 2023  
Page 4

---

If you have questions or comments regarding this report, please contact me.

Sincerely,  
KCI Technologies, Inc

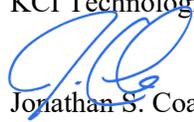

Jonathan S. Coale, CIH, CIEC  
Certified Industrial Hygienist  
KCI Technologies, Inc.